

FORD: 2001-2003 MUSTANG**ISSUE**

Some 2001-2003 Mustang Coupes may exhibit the headliner sagging in the rear of the vehicle.

ACTION

To service, install a push pin fastener to secure the headliner in its proper position. Refer to the following Service Procedure.

SERVICE PROCEDURE

1. Obtain Service Kit 1R3Z-63519E80-AA. The Kit will contain a template and push-pins.
2. Remove fuse #37 from the instrument panel fuse box for the dome lamp.
3. Remove the dome lamp lens (refer to Workshop Manual Section 417-02).
4. Remove the three (3) dome lamp screws as shown in Section 417-02 of the Workshop Manual.
5. Place the template from the Kit over the front two (2) holes in the dome lamp, with the other end of the template pointing towards the backglass.
6. Install the two (2) screws into the holes and hand tighten.
7. Pull the template straight back towards the rear of the car following the headliner contour.
8. Locate the rearward hole that is marked on the template.
9. While pushing the headliner towards the roof of the vehicle, use a pen to push through the marked hole on the template and mark the headliner.

NOTE

MAKE SURE THAT THE TEMPLATE IS STRAIGHT WITHOUT ANY SIDE TO SIDE VARIATION.

10. Move the template away from the pen mark and put a 5mm (0.20") hole in the headliner using an awl.

CAUTION

BE CAREFUL NOT TO PUSH THE AWL INTO THE ROOF SHEET METAL. IT WILL CAUSE A DENT ON THE ROOF EXTERIOR.

11. Install the appropriately colored push pin (included in the kit), by pushing it through the newly made hole in the headliner and into the existing rear sheet metal header hole.
12. Remove the dome lamp screws and remove the template.
13. Reassemble the dome lamp per Section 417-02 of the Workshop Manual.
14. Reinstall fuse #37 into the instrument panel fuse box.

PART NUMBER	PART NAME
1R3Z-63519E80-AA	Kit (Headliner Repair)

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage

OPERATION	DESCRIPTION	TIME
040102A	Install A Push Pin Fastener To Secure The Headliner	0.3 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
63519C08	07

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.